


WIRE COLOR LEGEND
 ALL WIRES BLACK UNLESS NOTED
 BR - BROWN W - WHITE
 G - GREEN R - RED
 Y - YELLOW BL - BLUE
 B - BLACK
 ALL WIRES 18 GA UNLESS NOTED

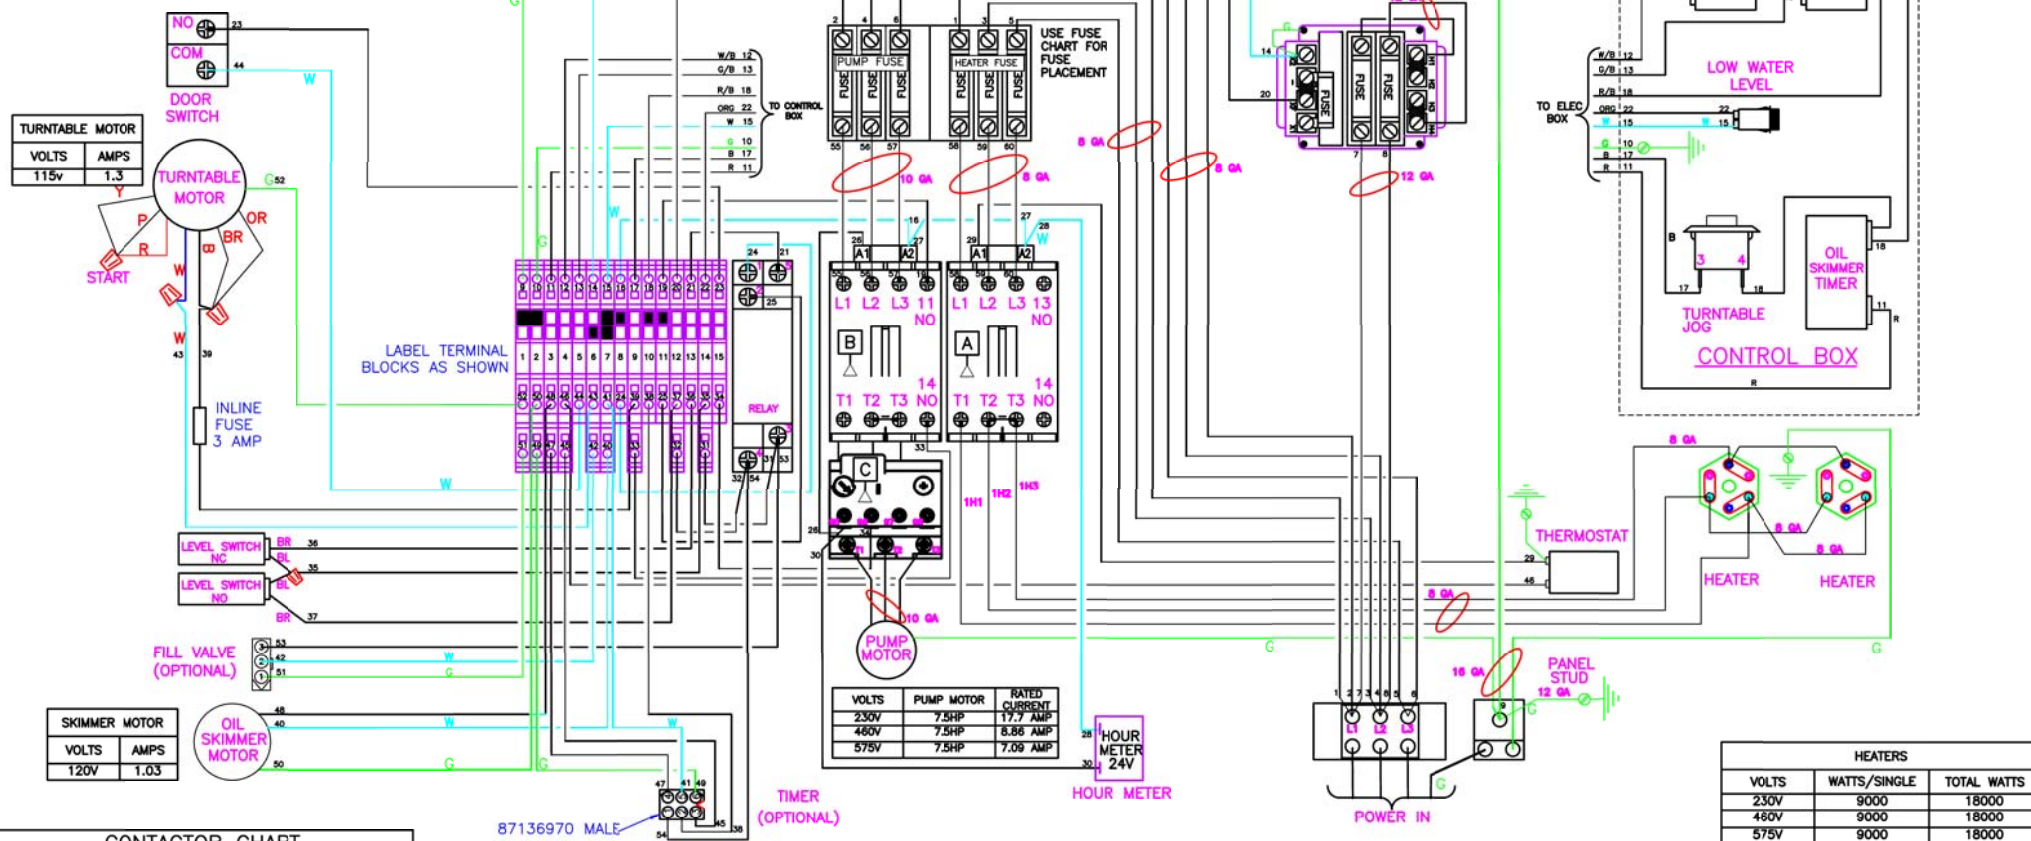

CONTACTOR CHART			
CONTACTOR	A	B	C (OVERLOAD)
230V	50 AMPS	40 AMPS	16.0-24.0
460V	30 AMPS	25 AMPS	10.0-16.0
575V	30 AMPS	25 AMPS	6.0-10.0 AMPS

87136970 MALE
 * PIN CALLOUT FROM INSERTION END

FOR REFERENCE ONLY

HEATERS		
VOLTS	WATTS/SINGLE	TOTAL WATTS
230V	9000	18000
460V	9000	18000
575V	9000	18000

FUSE CHART		
PUMP FUSE	HEATER FUSE	TRANSFORMER FUSE
LPJ-30SP	NON50	FNQ-R-3
LPJ-25SP	LPJ-30SP	FNQ-R-1 1/2
LPJ-10SP	LPJ-20SP	FNQ-R-1 1/2

REVISION HISTORY		APPLICABLE MACHINES	
REV	DESCRIPTION	ECN	DATE
A	RELEASE PRINT	5023987	10/2/15

PROPRIETARY & CONFIDENTIAL
 THE INFORMATION CONTAINED IN THIS DRAWING IS PROPRIETARY AND MAY CONTAIN TRADE SECRETS AND PATENTABLE SUBJECT MATTER WHICH ARE THE EXCLUSIVE PROPERTY OF KÄRCHER NORTH AMERICA. THIS DRAWING IS PROTECTED BY THE COPYRIGHT LAWS OF THE UNITED STATES. ALL UNAUTHORIZED COPYING IS PUNISHABLE BY FINE OR IMPRISONMENT.

ELECTRICAL WIRING DIAGRAM			
DESCRIPTION			
WIRING DIAGRAM, 7272, 230V/460V/575V	SIZE	MACHINE	DRAWING NUMBER
B	APW FRONT LOAD		9.801-753.0
			REV A
			SHEET 1 OF 1